

**Identification of specific 16x7 Ranger white steel wheels,  
6 stud on 139.7mm PCD, 30mm Positive offset, with red &  
blue lines**

Mullins Wheels has initiated a safety recall of certain wheels of Part Number: 360-670P30-67W

To assist dealers & customers to identify wheels in this recall we advise the following.

Wheels are **white finish with red and blue pin stripes** around the outer edge - See Fig 1

***Please note that other importers / Wholesalers also sell wheels with red / blue lines.***



Fig 1.

**Vehicles likely to be affected:** When sold these wheels were recommended for fitment to the following vehicles:

**Toyota** Hilux 4x4 - 2005 on

**Mitsubishi** Triton 4x2 and 4x4 2006 on, Pajero 2000 – 2007

**Holden** Rodeo 2003 on, Jackaroo, Colorado

**Isuzu** D-Max

**Nissan** Navara D22 2005 on, Pathfinder to 2004

Possible trailer use

## Procedure to identify wheels involved:

All wheels concerned have the centre disc protruding significantly beyond the well of the rim - see Fig 2. Note: Wheels with non protruding centre disc are NOT included in this recall - see Fig 3



**Fig 2 - Protruding Centre Disc**



**Fig 3 - Centre Disc Not Protruding**

If the centre disc is protruding (Fig 2 above) then these wheels must be checked for specific stamping - as follows

## Check These Wheel Stamping Marks:

1. On outer rim edge stamping may be as follows - see Fig 4



**Fig 4.**

**"Mullins Wheels Pty Ltd 16x7J Max Load 950KG 'MM YY'"**  
(The date code applicable is between 01 06 and 04 06 – Jan 2006 to April 2006)

2. If the above stamping is not present it will be necessary to remove a wheel from the vehicle to check the stamping on the rear of the wheel. Check the inner wheel rim surface and it may be stamped - see Fig 5



**"CSA 16x7J 'YY MM' 1150KG".**  
(The date code applicable is between 06 04 and 08 11 – April 2006 to Nov 2008)

**IMPORTANT:** Wheels in this recall with stamping (refer Fig 5 above) must also have "P30" stamped on the inside between the stud holes - see Fig 6



**16x7 wheels with date code as above but with "P13", "P0" or "N20" stamped between the stud holes ARE NOT part of this recall.**

During this inspection process please check for any visible crack on the wheel centre - see Fig 7.



**Wheels with a visible crack should immediately be removed from the vehicle.**

If you find that wheels on any vehicle are part of this recall contact Mullins Wheels on the **1300 882 779 helpline** or email [wheels@mullins.com.au](mailto:wheels@mullins.com.au) to arrange for a replacement product.


Please Note: For your reference

A copy of the Voluntary Safety Recall advertisement is provided below

# Product Safety Recall

16x7" white steel wheel, 6 stud 139.7 PCD,  
30P offset & red/blue lines

Mullins Wheels Pty Ltd advises of a safety recall of certain aftermarket wheels of Part No. 360-670P30-67W.

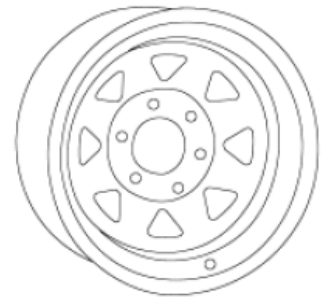

Defect: In extreme conditions the wheel centre may develop crack/s between the spokes. These wheels were sold from 1 February 2006 to 31 July 2009.

Hazard: Continued use of a wheel with cracked centre, may cause impaired control of the vehicle.

Vehicles likely to be affected: When sold these wheels were recommended for: **Toyota** Hilux 4x4 2005 on, **Mitsubishi** Triton 4x2 & 4x4 2006 on, Pajero 2000 - 2007, **Holden** Rodeo 2003 on, Jackaroo, Colorado, **Isuzu** D-Max, **Nissan** Navara D22 2005 on, Pathfinder to 2004, & possible trailer use.

What to Do/Contact Details Contact your wheel supplier to determine if wheels are in fact part of this recall or visit [www.wheels.com.au/wheels](http://www.wheels.com.au/wheels) or contact Mullins Wheels Pty Ltd on 1300 882 779 or email [wheels@mullins.com.au](mailto:wheels@mullins.com.au) for replacement.

See [www.recalls.gov.au](http://www.recalls.gov.au) for  
Australian Product Recall Information